TRAC DOCK DIRECTIONS

LEG ASSEMBLY

INSERT 2 3/8 X 1" BOLTS W/ SQUARE NUTS IN TO SLOTS ON THE BOTTOM OF THE LEG POCKET AND ALIGN W/ HOLES. THEN INSERT THE LEG INTO THE POCKET. HAND TIGHTEN THE BOLTS THEN A 1/2 TURN W/ A 9/16" WRENCH OR TILL SNUG.
FOR ADDED STABILITY TURN FOOT PAD HORIZONTAL TO THE SHORE.

BOLT ON LEG POCKETS

MOUNTS TO BOTTTOM OF FRAME
USING THE TRAC W/ 3/8 X 1 1/4" SQ.
HEAD BOLTS, WASHERS AND NYLOCKS

CROSS BRACING FOR STATIONARY LEGS

BRACKET SLIDES OVER THE STATIONARY LEG BELOW THE LEG POCKET, ATTACH U-BOLT OVER LEG W/ STRAP.

DOCK EXTENDERS, 5' , 10' , 15'

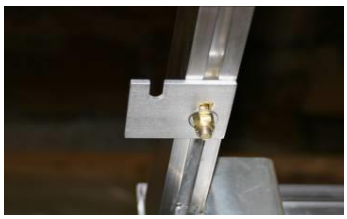

BOLT PLATES ON REAR CROSS BAR W/ 3/8" X 1 1/4" SQ. HEAD BOLT & NYLOCK. POSITION PLATES SO THE NOTCHED HOLE IS FACING THE CENTER OF THE DOCK.POSTION NEXT SECTION OF DOCK ON THE PLATES, SLIDE 3/8" X 1 1/4" SQ. BOLTS INTO THE TRAC AND POSITION IN THE SLOTTED HOLES AND TIGHTEN. THEN SLIDE 4 3/8" X 3 3/4" BOLTS THRU HOLES IN THE SIDE OF THE CROSS BAR AND TIGHTEN.

SIDE DECKS, T'S AND L'S

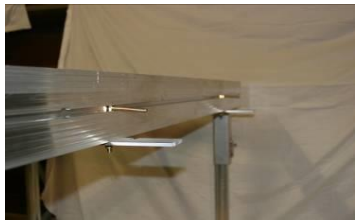

BOLT PLATES ON BOTTOM OF SIDE FRAMES W/ 3/8" X 1 1/4" SQ. HEAD BOLT & NYLOCK. POSITION 2 3/8" X 2 1/4" SQ. HEAD BOLTS IN SIDE TRAC TO ALIGN W/ PREDRILLED HOLES. PLACE DOCK FRAME ON PLATES AND SLIDE SIDE BOLTS THRU HOLES AND TIGHTEN WITH WASHER AND NYLOCK. THEN SLIDE 3/8" X 1 1/4" SQ. HEAD BOLTS INTO BOTTOM TRAC AND POSITION IN THE SLOTTED HOLES AND TIGHTEN.

QUICK CONNECTORS

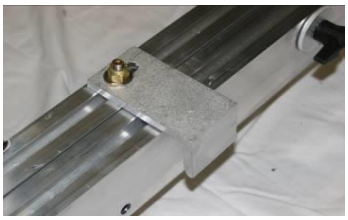

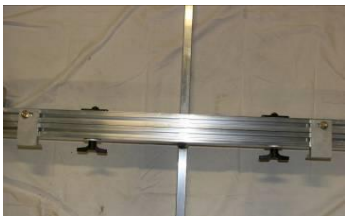

BOLT L PLATE TO BOTTOM TRAC USING 3/8" X 1 1/4" SQ. HEAD BOLT & NYLOCK. SCREW CAST PLATES TO INSIDE OF NEXT REAR BAR USING 14 X 1" TECK SCREWS, ALIGNED W/ HOLES IN CROSS BAR. SET SECTION OF DOCK ON TO PLATE, ALIGN HOLES, INSET HANDLE W/ THREADED ROD W/ ALUMINUM WASHER, S.S. WASHER AND LOCK WASHER AND TIGHTEN.